

Manhole Inspection Summary

Manhole # S39A__009MH

Printed On: 10/31/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39A** Node: **009** Status: **Found**

Insp Date: **11/29/07 9:15 AM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **forrest st**

Cross Street: **old town mall orleans st entrance**

Manhole Type: **Inline** Location: **Parking Lot** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **was first done on 11/29/07 got the bad crack in the frame & re did top view so pipe at 12 is at 12oclock**

Cover Shape: **Circular** Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☐ Sound ☒ **Cracked** ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Concrete** ☐ Parged Type: **Flat top**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Concrete** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Location View



Top View



new top view

Cracked frame




additional view of crack in frame

Defect 2



top view of crack in frame

Defect 1

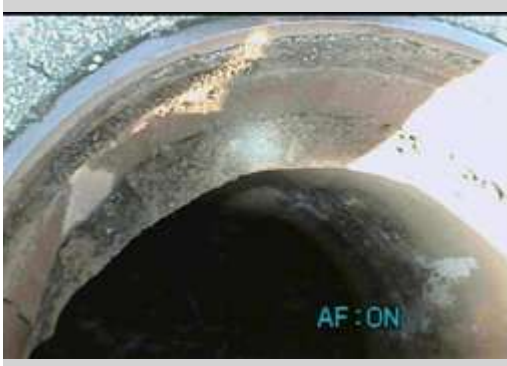

offset

Manhole Inspection Summary

Manhole # S39A__009MH

Printed On: 10/31/2008

Page 3 of 3

4 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.75** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 1 (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

4 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.50** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection